



Elite Ecology

Passionate about Ecology

Land Adjacent to Forest Hill Golf Club, Bagworth and Thornton



BS5837:2012 Tree Survey

November 2024



01782 308418



Part of Harmil Environmental Ltd.
Company Reg Number: 11310919
Company VAT Number: 320559225

www.eliteecology.co.uk
admin@eliteecology.co.uk



The New Barn, Suites 2/3, Shellow Lane,
Gawsworth, Cheshire, CW12 2FQ



Document Control			
Document Properties			
Organisation	Elite Ecology		
Prepared For	Forest Hill Golf Club		
Author	Mr. David Whitehead		
Approved (1 st Checker)	Mr. Marek Fraczek		
Approved (2 nd Checker)	Mr. Richard Millington		
Title	Land Adjacent to Forest Hill Golf Club, Bagworth and Thornton BS5837:2012 Tree Survey		
Version History			
Date	Version	Status	Description/Changes
06/11/2024	V1	First Draft	Initial Draft
06/11/2024	V1	Final Report	Proofread

0. Executive Summary

- 0.1** This report has been prepared at the request of Forest Hill Golf Club. Elite Ecology were commissioned to undertake a BS 5837 Tree Survey and Arboriculture Impact Assessment at Land Adjacent to Forest Hill Golf Club, Thornton Lane, Bagworth and Thornton, Botcheston, Leicestershire, LE9 9FH (Central OS Grid Reference: SK 48060 06267). This survey effort involved both a desktop study and field survey being undertaken.
- 0.2** The current proposals are for a hotel complex with additional parking and access roads located predominantly to the east of the Forest Hill Golf Club.
- 0.3** The survey records all trees within the site and any that may be impacted by the development proposals within or outside of the site boundary. The survey records a number of parameters including, species, crown/canopy spread, and diameter at breast height (DBH).
- 0.4** Throughout this report "RPA" is used to refer to "root protection area". The RPA of any given tree is the area of ground which should not be disturbed by excavation, compaction, changes in level and/or any other construction/demolition processes. The extent of the RPA is calculated in accordance with the BS5837 (2012) guidelines.
- 0.5** In total the survey recorded two individual trees, three groups of trees, and three hedgerows. These were a range of predominantly native and non-native broadleaf and coniferous specimens. The age class was observed to be predominantly **semi-mature**, and the general overall condition was observed to be predominantly good for all trees and hedgerows at the site.
- 0.6** In total the survey recorded two category **B** trees, and three category **B** group of trees. The survey also recorded one category **A** woodland. No category **C** or **U** trees were recorded.
- 0.7** The proposal area comprises 1.22 HA of land to the south of Forest Hill Golf Club. The site itself is largely devoid of trees but is bordered to the south-east, and east by a well-established mixed-species hedgerow interspersed with young to semi-mature trees, and to the north-east by an area of semi-mature woodland. The majority of vegetation within the site to the east has been cleared; however, a semi-mature coniferous hedgerow remains to the west of the proposed structure, adjoining the overflow car park. Additional hedgerows and small trees located near the proposed structure were observed and have also been recorded. The tree population at the site was observed to be in a predominantly good overall condition. The trees at the site provide a reasonable amount of amenity value within the immediate area, with the woodland area (**W1**) being significantly important within the overall landscape.

Contents

0. Executive Summary	2
1. Introduction	4
1.1 Report Rationale	4
1.2 Purpose	4
1.3 Site Description	4
1.4 Current Proposals	6
2. Survey Methodology	6
2.1 Tree Categorisation	7
2.2 Life Stages	8
2.3 Physiological and Structural Condition	9
3. Statutory Protection and Guidance	9
3.1 Statutory Protection and National Planning Policy Framework (NPPF)	9
3.2 Tree Preservation Orders and Conservation Areas	9
3.3 Felling Licences	10
3.4 Trees Outside of the Property	10
3.5 Implementation of Tree Work	10
3.6 Wildlife	10
4. Results	12
5. Summary of Results	16
5.1 Species Composition	16
5.2 Tree Survey Findings	17
6. Summary of Results	20
6.1 General Condition and Observations	20
6.2 Visual Tree Assessment (VTA)	20
6.3 Structural Condition	20
6.4 Physiological Condition	20
7. Preliminary Recommendations	21
7.1 Tree Work Recommendations	21
7.2 Arboricultural Impact Assessment	21
8. References	23
9. Appendices	23
Appendix A: Tree Constraints Drawing	25
Appendix B: Photographic Records	26
10. Notice to Readers: Conditions of this Report	31

1. Introduction

1.1 Report Rationale

This report has been prepared at the request of Forest Hill Golf Club. Elite Ecology were commissioned to undertake a BS 5837 Tree Survey and Arboriculture Impact Assessment at Land Adjacent to Forest Hill Golf Club, Thornton Lane, Bagworth and Thornton, Botcheston, Leicestershire, LE9 9FH (Central OS Grid Reference: SK 48060 06267). This survey effort involved both a desktop study and field survey being undertaken.

Elite Ecology is a multi-disciplinary ecological and arboricultural consultancy practice which operates nationwide for its clients on a multitude of ecological and arboricultural projects since 2015. The author of this document, **Mr. David Whitehead**, is a time served climbing arborist and arboriculturist with twenty years of experience within the arboricultural industry, and is currently qualified to RQF level 4, Foundation Cert - Arboriculture and tree management, and also holds the LANTRA Professional Tree Inspectors qualification. The overseer of this document, **Mr. Richard Millington**, ACIEEM, MRSB, MArborA, is a Company Director, and is currently qualified to RQF level 6 with a BSc (Hons) in Ecology and Conservation Management.

1.2 Purpose

This report was carried out in accordance with BS5837 (2012) "*Trees in relation to design, demolition and construction*". The purpose of this report is to provide an analysis and assessment of the subject trees at the site. The report identifies and evaluates the trees, assigning them a category value. The report presents the physical data of the trees and shows the constraints that the trees present within and outside of the site area.

The report provides professional advice and recommendations in order to ease any conflicts and to help devise a suitable proposal that considers the tree population at the site.

1.3 Site Description

The proposal area comprises 1.22 HA of land to the south of Forest Hill Golf Club. The site itself is largely devoid of trees but is bordered to the south-east, and east by a well-established mixed-species hedgerow interspersed with young to semi-mature trees, and to the north-east by an area of semi-mature woodland. The majority of vegetation within the site to the west has been cleared; however, a semimature coniferous hedgerow remains to the south of the proposed structure, adjoining the overflow car park. Additional hedgerows and small trees located near the proposed structure were observed and have also been recorded.

1.3.1 Root Barriers

No significant root barriers were identified. Where an existing surface or structure is expected to have restricted root distribution then this will be shown/highlighted on the tree constraints and protection drawings as a dashed magenta coloured line. Any deviation from the standard calculated RPA will be discussed in the arboricultural

impact assessment document and displayed in the associated drawings. Drawing Reference: **EEARB0120** and **EEARB0120.1**

1.3.2 Soils

A search of the Landis.org.uk national soils database describes the soil in this area as slowly permeable seasonally wet slightly acid but base-rich loamy and clayey soils. This information suggests that the soil here has a potential to be of a shrinkable nature. The potential of root systems to exasperate seasonal climatic conditions via their water uptake, and the consequent effect that this can have on soil volume, (which can affect foundations and cause the movement of such) should be a primary consideration when designing foundations and expert advice regarding this should be sought from a qualified structural engineer.

This information and the condition of the existing trees and vegetation at the site suggests that the soil here is a good planting medium. A site-specific tree planting and establishment report should be produced to advise any tree planting proposals for the site.

No in-depth soil analysis was undertaken, and no samples were taken or studied.

1.3.3 Topography and Levels

The site is predominantly flat and level with no major deviations in elevation. No significant topographical features were observed at the site.

Figure 1: An aerial image showing the location and survey area at Forest Hill Golf Club.



1.4 **Current Proposals**

The current proposals are for a hotel complex with additional parking and access roads located predominantly to the south of the Forest Hill Gold Club.

2. **Survey Methodology**

The pre-development survey and assessment of the trees on site was undertaken in accordance with the British Standard 5837:2012 'Trees in Relation to Design, Demolition and Construction – Recommendations' (BS5837:2012).

These assessments were made from ground level only and is based on a visual inspection of the trees within the area. No invasive investigations, no tissue samples and no soil samples were gathered from this survey effort. This survey aimed to examine external features of the trees. Any growing conditions were noted down, with any obvious signs of physical and/or structure defects are recorded (this includes deadwood, die-back or any signs of decay).

In accordance with the aforementioned recommendations, the tree survey included all specimens that are within the site boundary with a diameter at breast height (DBH) of 75mm or above.

This DBH is then used to calculate the Root Protection Area (RPA) of the specimens on site. The RPA represents the minimum area around each tree that must be left undisturbed to ensure their survival. The majority of the tree roots are found in the top 600mm of soil, with most of the nutrient absorbing fine roots found within the top 100mm. The morphology of the roots is influenced by the presence of other site factors (such as roads, structures), soil type, topography and drainage. Where no RPA is identified in the table above, the canopy line should be treated as the RPA (this typically applies to small trees).

A topographical survey has been undertaken on the site prior to the field survey.

The field survey obtained numerous factors about the trees. The equipment used to gain measurements were a diameter tape, a laser measure, and a clinometer. The information collected on the trees is as follows:

- Tree Number/Group Reference.
- Species.
- Height.
- Branch Spread.
- Height and direction of First Significant Branch.
- Age Class.
- Physiological and Structural Condition.
- Estimated Remaining Contribution (Years).
- Management Recommendations.
- Notes.

2.1 Tree Categorisation

Trees are graded in accordance with the Cascade Chart for Tree Quality Assessment. The purpose of the categorisation is to identify the value of the existing trees, allowing for informed decisions to be made in order to comply with BS5837:2012. These categories are **A**, **B**, **C**, and **U**. Trees categorised as **U** have sound reasons for removal. Trees that fall within categories **A**, **B**, and **C** should be considered for retention. The categories are as follows:

○ Category A:

Trees that are of high quality, with an estimated remaining life span of at least forty years.

Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semiformal arboricultural features.

Trees, groups, or woodlands of particular visual importance as arboriculture and/or landscape features.

Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture).

Trees in this category will be shown **light green** on the Tree Survey Plan.

○ Category B:

Trees of moderate quality, with an estimated remaining life span of at least twenty years.

Trees that might be included within **Category A**, but have been downgraded due to impaired condition, such that they are unlikely for retention beyond forty years.

Trees that do not contain the special quality necessary to be classified as **Category A**.

Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals.

Trees occurring in collectives but situated to contribute little to the local visual amenity of the area.

Trees with material consideration or other cultural value.

Trees in this category will be shown **mid-blue** on the Tree Survey Plan.

○ Category C:

Trees that are of low quality with an estimated life span of at least ten years, or young trees with a stem diameter below 150mm.

Trees of limited merit and impaired condition so as to not be classified at a higher category.

Trees present in groups or woodlands that are significantly greater collectively within the landscape.

Trees that offer minimal or temporary landscape benefits.

Trees with no material conservation or other cultural value.

Trees in this category will be shown **grey** on the Tree Survey Plan.

○ **Category U:**

Trees that are in a condition where they cannot be realistically retained as living trees for longer than ten years.

Trees that have a serious, irremediable, structural defect that their loss would be due to collapse. This includes specimens that will not be viable following the removal of further **Category U** trees.

Trees that are dead or are showing signs of significant, immediate, and irreversible decline.

Trees infected with pathogens or diseases that are harming the specimen itself or is at risk of infecting nearby trees.

Trees that are of very low quality that are suppressing other nearby trees of higher landscape or ecological value.

Trees in this category will be shown **dark red** on the Tree Survey Plan.

2.2 **Life Stages**

All of the trees are separated into five life stages. These are as follows:

- **Young (Y)** – Newly planted or early established trees that are less than 150mm. These can easily be replaced.
- **Semi-mature (SM)** – Tree within the first quarter of its life span. Increasing in height and spread.
- **Early Mature (EM)** – Tree within the second quarter of its life span. Usually increasing in height and spread.
- **Mature (M)** – Tree within the third quarter of its life span. Usually at full height expectancy.
- **Over Mature (OM)** – Trees within the final quarter of its life span, or those that have exceeded their life expectancy. These can be in decline.

2.3 Physiological and Structural Condition

These conditions are categorised as either **good**, **fair**, **poor**, or **dead**.

An assessment of a tree's physiological condition is defined as:

- **Good** – A fully functioning biological system showing expectant vitality for the species (i.e. normal bud growth, leaf size, crown density and wound closure).
- **Fair** – A fully functioning biological system showing below average vitality for the species (i.e. reduced bud growth, smaller leaf size, lower crown density and reduced wound closure).
- **Poor** – A limited biological system showing physiological decline, disease or significantly below average vitality (i.e. limited bud growth, small and chlorotic leaves, low crown density and limited wound closure).
- **Dead** – Those trees marked **dead** have no visible foliage and brown cell structure under young bark.

An assessment of a tree's structural condition is defined as:

- **Good** – No significant structural defects.
- **Fair** – Structural defects that could be alleviated through remedial tree surgery or arboricultural management practices.
- **Poor** – Structural defects which cannot be alleviated through tree surgery or arboricultural management practices.
- **Dead** – Those trees marked **dead** have no visible foliage and brown cell structure under young bark.

3. Statutory Protection and Guidance

3.1 Statutory Protection and National Planning Policy Framework (NPPF)

Any area of ground that has been continuously wooded since 1600AD is defined as an ancient woodland. Any tree of significant size, age, ecological value, amenity value, cultural, and/or heritage value, is classed as a veteran tree. The NPPF assumes protection of all such trees and woodlands with exceptions made only in extreme circumstances where suitable mitigation strategies exist.

No veteran trees or ancient woodland exists at the site.

3.2 Tree Preservation Orders and Conservation Areas

A search of the local authority interactive planning map has revealed that none of the subject trees recorded at the site are protected by tree preservation orders. Furthermore, the site is not within a conservation area.

Any advice given in this report is strictly advisory and does not overrule, bypass or otherwise in any way grant the client permission to carry out works on any of the

trees included within the survey. Trees that are protected by TPO **require the express permission of the local district authority and/or their acting tree officer before any works may be carried out on them.**

Trees existing within a conservation area are protected by Section 211 of the Town and Country Planning Act 1990, in that anyone wishing to carry out work of any kind on such trees is required to submit a Section 211 application with the Local Authority, allowing six weeks' notice for any works. During such time, the Local Authority may assess such trees with a view to issuing further protection via TPO's if considered necessary.

3.3 Felling Licences

Tree felling in the United Kingdom is controlled by the Forestry Commission under the Forestry Act 1967. In a calendar quarter (three months), up to 5m³ can be felled without requiring a felling licence providing that no more than 2m³ are to be sold. If any felling proposed does not meet the aforementioned criteria, then a felling licence will be required. It is worth noting that some types of felling are exempt, such as the removal of deceased trees, or ones that are dying, dangerous, or causing a nuisance.

3.4 Trees Outside of the Property

If works are recommended to be undertaken on trees that fall outside of the client/applicant's land, the full co-operation and liaison with these tree owners is necessary. Implications of not cooperating requires additional legal interpretation that are beyond the remit of this report. Under Common Law, branches from trees on adjacent properties that extend over boundaries can be pruned back to the boundary line without the permission of the owners.

3.5 Implementation of Tree Work

When appointing a tree contractor, only suitably qualified and experienced companies should be used. Always ensure that the contractor carries adequate insurance. The contractor should carry out all tree works to BS 3998:2010 *Recommendations for Tree Work*, as modified by more recent research findings.

3.6 Wildlife

All operations need to take into account the presence and/or potential presence of any wildlife at the site.

- 3.6.1 **Bats** All trees with potential roosting features (PRF's) need to be assessed by a licenced bat surveyor. All bats and their roosts are protected by the legal framework within the United Kingdom. It is an offence to kill, injure, or disturb a bat and to destroy or damage any place that is used for shelter by a bat.

3.6.2 Birds

All breeding birds are protected by law within the United Kingdom. Therefore, any tree removal should take place outside of the breeding bird season (March to August inclusive). If this cannot be achieved, a suitably qualified and experienced ecologist is

required to inspect for any nests. If an active nest is located, an exclusion zone will then be implemented around this feature until any chicks have fledged the nest.

4. Results

The field survey at the site and its close surrounding area to the south and west assessed the individual condition and value of two individual trees, three group of trees, and three hedgerows.

Tree No.	Species	Tree Category (U/A/B/C)	Life Stage (Y/SM/EM/M/OM)	Condition (Good/Fair/Poor/Dead)	Number of Stems	Height (m)	Branch Spread (m)				Lowest Significant First Branch (m)	Stem at Breast Height (mm)	Remaining Contribution (years*)	Root Protection Area (m ²)	Root Protection Radius (m)	Observations
							N	E	S	W						
T1	Crack willow (<i>Salix Fragilis</i>)	B2	SM	Good	1	10	3	3	3	3	2.5S	400	20+	72	4.8	Previous pollarding works apparent. Reduced crown.

BS5837:2012 Tree Survey

T2	Field maple (<i>Acer campestre</i>)	B1	SM	Good	1	8	2	2	2	2	2S	200	20+	18	2.4	
G1	Leyland cypress (<i>Cupressus</i> × <i>leylandii</i>)	B2	SM	Good	-	10	2	2	2	2	-	MIN 300 MAX 350	20+	-	MIN 3.6 MAX 4.2	
G2	Leyland cypress (<i>Cupressus</i> × <i>leylandii</i>)	B2	SM	Good	-	5	0.5	0.5	0.5	0.5	-	MIN 150 MAX 200	20+	-	MIN 1.8 MAX 2.4	
G3	English oak (<i>Quercus robur</i>) Common ash (<i>Fraxinus excelsior</i>) Field maple (<i>Acer campestre</i>) Common hawthorn (<i>Crataegus monogyna</i>)	B2	SM	Good	-	RANGE 5-12	AVG 3	AVG 3	AVG 3	AVG 3	-	MIN 80 MAX 350	20+		MIN 0.9 MAX 4.2	Predominantly mixed species hedgerow but with some larger good quality trees interspersed throughout, particularly towards the eastern aspect and adjacent to the highways
H1	Common hawthorn (<i>Crataegus monogyna</i>)	-	SM	Good	-	RANGE 1.5-2.5	2	2	2	2	-	80	-	-	-	Internal hedgerow. 2M buffer zone recommended

BS5837:2012 Tree Survey

H2	Common hawthorn (<i>Crataegus monogyna</i>)	-	SM	Good	-	RANGE 1.5-4	2	2	2	2	-	80	-	-	-	Internal hedgerow. 2M buffer zone recommended
H3	Common hawthorn (<i>Crataegus monogyna</i>)	-	SM	Good	-	RANGE 3-4	2	2	2	2	-	80	-	-	-	Northern periphery boundary hedgerow with mixed species woodland behind. 2M buffer zone recommended
W1	Common hawthorn (<i>Crataegus monogyna</i>) English oak (<i>Quercus robur</i>) Common ash (<i>Fraxinus excelsior</i>) Field maple (<i>Acer campestre</i>)	A1	RANGE Y-EM	Good	-	RANGE 3-4	AVG 5	AVG 5	AVG 5	AVG 5	-	MIN 80 MAX 800	40+	-	MIN 0.9 MAX 9.6	Mixed species woodland.
TOTALS		Category Grading		Life Stages		Condition		NOTES:								
		A	1	Y	0	GOOD	9									
		B	5	SM	8	FAIR	0									
		C	0	EM	0	POOR	0									

	U	0	M	0	DEAD	0	
			OM	0			

5. Summary of Results

The field survey found the following information about the trees located on the survey site and within the sphere of influence:

5.1 Species Composition

In total, six species were identified on and around the survey site. The trees identified were:

- **T1:** Crack willow (*Salix Fragilis*).
- **T2, G3 and W1:** Field maple (*Acer campestre*).
- **G1 and G2:** Leyland cypress (*Cupressus × leylandii*).
- **G3 and W1:** English oak (*Quercus robur*).
- **G3 and W1:** Common ash (*Fraxinus excelsior*).
- **G3, W1, H1, H2 and H3:** Common hawthorn (*Crataegus monogyna*).

Note: The mixed species woodland situated to the north-east (**W1**) is a diverse woodland and only dominant species have been recorded.

5.2 Tree Survey Findings

All trees surveyed at the site were assessed, evaluated, and categorised in accordance with BS 5837 – *Trees in Relation to Design, Demolition and Construction* 2012. This information is summarised in the table below.

LIFE STAGES		CONDITION		BS 5837 CATEGORY		
Subject Tree/ Group	Life Stage	Subject Tree/ Group	Condition	Subject Tree/ Group	Category	Sub cat
W1	Young	All subject trees and hedgerows	Good	Total 1	A	
				W1	A	1
					A	2
					A	3
T1, T2, G1, G2, G3, H1, H2, H3	Semi-mature	None	Fair	Total 5	B	
				T2	B	1
				T1, G1, G2, G3	B	2
					B	3
W1	Early-mature	None	Poor	Total 0	C	
					C	1
					C	2
					C	3

None	Mature	None	Dead	None	U	
None	Over-mature					

Figure 2: An extract of the grading criteria.

BS5837:2012 Table 1 – Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention (see Note)				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality <i>NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see [BS5837:2012] 4.5.7.</i>			
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	

6. Summary of Results

6.1 General Condition and Observations

- 6.1.1 The tree population at the site was observed to be in a predominantly good overall condition. The trees at the site provide a reasonable amount of amenity value within the immediate area, with **W1** being significantly important within the overall landscape.

6.2 Visual Tree Assessment (VTA)

A VTA was carried out from ground level. The assessment looked for cavities, fractures, breaks, cracks, and signs of stress through tension and compression from the base and throughout the main body/bole of the subject within the reasonably visible limits. The assessment also looked for signs of decay, fungal bodies and/or signs of insect infestation, along with the overall vitality of the subject and its organs. The assessment considered the location of the subject and its position, form, elemental exposure and proximity to neighbouring structures and public areas. The surrounding ground was also assessed for cracks and signs of movement or heave that may relate to root plate movement.

6.3 Structural Condition

Trees are multi-cellular living organisms and can be subject to rapid change over short periods of time. All observations were accurate at the time of survey. The general structural integrity of the subject trees is thought to be good at this time. No major cracks, fractures, breaks, or cavities was observed on any of the subject trees.

6.4 Physiological Condition

The detection of disease, infection, and infestation are subject to seasonal and climatic conditions. Some fungus, insect infestation, and diseases are only apparent when they are in season and may be easily undetected at certain other times of the year. At the time of survey, no significant physiological disorder was observed on any of the subject trees.

7. Preliminary Recommendations

7.1 Tree Work Recommendations

No tree works are recommended for the subject trees at this time.

7.1.1 Tree Inspection

All trees within a close proximity to public areas and roads should be regularly inspected and assessed for potential risk and hazards.

It is recommended that the subject trees are inspected at regular intervals. The recommended interval for the subject trees at the site is every three years.

7.1.2 Tree Retention

As a general standard, it is recommended that all trees that have been categorised as category **A** and **B** trees should be considered for retention. These trees are of a good quality, condition, and value, and will offer greater amenity, aesthetic, ecological and environmental benefits than that of replacement plantings.

7.1.3 Tree Removals

Trees categorised as category **C** may be considered for removal (where they are within the site boundary and ownership has been identified) as these trees are of a relatively low value and can be easily replaced with new plantings.

Where it is unavoidable to propose the removal of category **A** and/or **B** trees. Then a suitable mitigation strategy should be produced to compensate for any tree loss.

7.1.4 Design Guidance

Due to multiple tree root systems from **G1** being present within the proposal area, it is strongly recommended that any proposed structures should be designed with minimal excavation requirements. All new proposed surfaces should be permeable and unsealed in order to prevent the dehydration of the soil environment beneath. It is recommended that a two metre buffer zone adjacent to **G1** is allowed and incorporated into any design proposal. This area should not be surfaced and should remain grassed or covered with bark/wood chippings.

7.2 Arboricultural Impact Assessment

7.2.1 Assessment of Proposal

It is recommended that a full arboricultural impact assessment is conducted to assess the impacts of any proposal upon the subject trees at the site. The impact assessment should be carried out once a detailed site plan has been produced which includes details of any excavations, re-surfacing works and any new structures proposed for the site, along with routes for utilities and SuDs.

7.2.2 Consultation

Cross consultation should be conducted between all disciplines involved in the project to gain a thorough understanding of the project and any ramifications of the impacts identified.

7.2.3 Arboricultural Method Statement and Tree Protection

The arboricultural impact assessment should include a detailed site-specific method statement that details and lists the operations, methodologies, and protection measures that must be employed to minimise any impact of any works that are to take place within close proximity to or within the root protection area of any of the subject trees identified at the site. This should be accompanied by a detailed tree protection drawing.

8. References

- Arboricultural Practice Note 12: (2007) *Through the Trees to Development*. Arboricultural Advisory and Information Service.
- Bat Conservation Trust (2023). Bat Surveys – Good Practice Guidelines. 4th Edition. Bat Conservation Trust: London
- British Standard BS 3998: (2010) *Tree Work-Recommendations*.
- British Standard BS 5837: (2012) *Trees in Relation to Construction*.
- Countryside and Rights of Way Act 2000 (c.37). London: HMSO.
- Health and Safety Executive (revised 2006) *Essentials of Health and Safety at Work*. HSE Books.
- Lonsdale, D. (1999) *Principles of tree hazard assessment and management*, Research for amenity trees No. 2. HMSO, London.
- Mattheck, C. and Belier, H. (1994) *The body language of trees*. Research for amenity trees No. 4. HMSO, London.
- Mynors C. (2002) *The Law of Trees Forests and Hedgerows*. Sweet and Maxwell
- National Tree Safety Group (2011) *Common sense risk management of trees*. The Forestry Commission, Edinburgh.
- Planning Practice Guidance – *Tree Preservation Order and trees in conservation areas* – 2014
- Shigo, A. L. (1989) *A new tree biology*. Shigo and Trees Associates, Durham, New Hampshire.
- Stouts R. G. and Winter T. G. (1994) *Diagnosis of ill-health in trees*, Research for amenity trees No. 2. HMSO, London.
- The Conservation of Habitats and Species Regulations 2017 (Amendment). SI 2017/1012.
- Watson, G. and Green T. (2011) *Fungi on trees*. Arboricultural Association, Stonehouse, Gloucestershire.
- Wildlife and Countryside Act 1981 (and amendments) (c.69). London: HMSO.

9. Appendices


Appendix A: Tree Constraints Drawing

Appendix B: Photographic Records

BS5837:2012 Tree Survey

Appendix A: Tree Constraints Drawing

DO NOT PRINT FROM THIS DOCUMENT

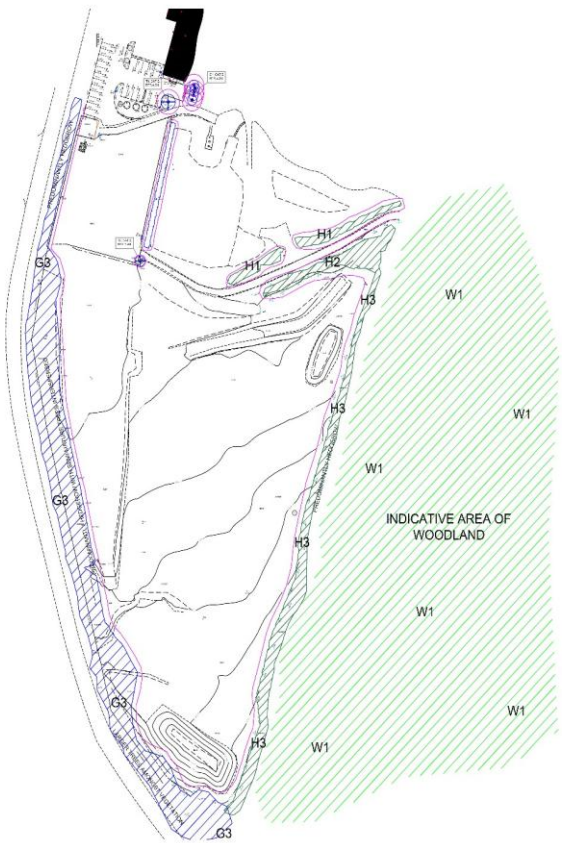

ELITE ECOLOGY
Professional Ecological and Arboriculture Consultants
Registered in England No. 1055837
VAT No. 959 054 123

TREE CATEGORY

RPA

CANOPY DISTRIBUTION

RPA HEAVILY OVERLAP OR RESTRICTED

RPAS FOR TREES MEASURED FROM NEAREST STEM
T1 - 4.8M
T2 - 2.4M
G1 - MAX 4.2M
G2 - MAX 2.4M
G3 - MAX 4.2M
H1 - MAX 3M
H2 - MAX 2M
H3 - MAX 2M

THIS DRAWING WAS ORIGINALLY PRODUCED IN COLOUR A MONOCHROME COPY SHOULD NOT BE RELIED UPON

THIS DRAWING IS INTENDED TO BE USED IN CONJUNCTION WITH THE BS5837 TREE SURVEY DOCUMENT WHICH SPECIFIES ALL RPAS AND CANOPY DISTRIBUTIONS

TOPOGRAPHICAL DRAWING REF:
2819

RPAS FOR HEDGEROWS AND GROUPS OF TREES ARE INDICATIVE AND SHOULD BE MEASURED ON SITE

1:200 @A2

TREE CONSTRAINTS

DRAWN BY: D. WHITEHEAD
DATE: 05/11/2024
SITE ADDRESS: FOREST HILL GOLF CLUB
CLIENT: FOREST HILL GOLF CLUB

DOCUMENT NUMBER: EEARB120

Appendix B: Photographic Records

Plate 1: T1.



Plate 2: T2.



Plate 3: G1.



Plate 4: G2.



Plate 5: G3 at the southern aspect of the site.



Plate 6: G3.



Plate 7: G3.



Plate 8: H1.



Plate 9: H2.



Plate 10: H3.



10. Notice to Readers: Conditions of this Report

All reports are certified products and cannot be shown, copied, or distributed to third parties without the written permission of Elite Ecology. No liability is accepted for the contents of the report, other than to that of the client(s). If any part of this report is altered without the written permission of Elite Ecology, then the whole report becomes invalid.

Elite Ecology agrees to supply ecological and arboricultural consulting services and advice of a preliminary or thorough nature as advised or commissioned. Upon commissioning Elite Ecology to undertake the work, the client(s) grant access to the site upon the agreed date. If no site access is available upon this date, Elite Ecology holds the right to charge the client(s) for lost staffing time and additional travel costs.

Elite Ecology undertake all site surveys with reasonable skill, care, and diligence, within the terms of the contract that has been agreed with the client and abiding by the Elite Ecology Terms and Conditions. The actions of the surveyors on site, and during the production of the report, were undertaken in accordance with the Code of Professional Conduct for the Chartered Institute of Ecology and Environmental Management.

The latest good practice guidelines put in place by Natural England or the relevant statutory conservation bodies have been followed by the surveyors on site. If those methodologies fail to identify a protected species during the survey efforts, no responsibility can be attributed to Elite Ecology. If any of these guidelines are adapted between the date(s) of the surveys being undertaken and the submission of this report, then Elite Ecology takes no responsibility for this.

Should any equipment be damaged or lost on site at the fault of the client(s), then Elite Ecology withholds the right to charge 100% above the current market value for that exact product or the nearest similar product.

The survey results purport the current status of the site and its potential for protected species utilisation at the time of surveying. It should not be viewed as a complete list of the possible flora and fauna species that could be using the site at different times of the year.

Elite Ecology has been provided with full payment for this report and thus the product has been released to the client(s) for the purpose of their planning application. If any part of the report is lost or altered without the written permission of Elite Ecology, then the entire report becomes invalid. Due to the potential for continual change within the natural world, this report is valid for **1 year only** from the date of the last survey visit. If this report is submitted after the 1 year deadline, then a further updated inspection will be required to ascertain whether the site remains in the same condition as it was when initially inspected.

No reliance should be made on any such comments in relation to the structural integrity of the features located on the surveyed site. All information within the report is based solely on evidence that has been found on site during the service provided. No individual opinion or inference will be made other than that of the suitably qualified ecologist appointed to the project.