
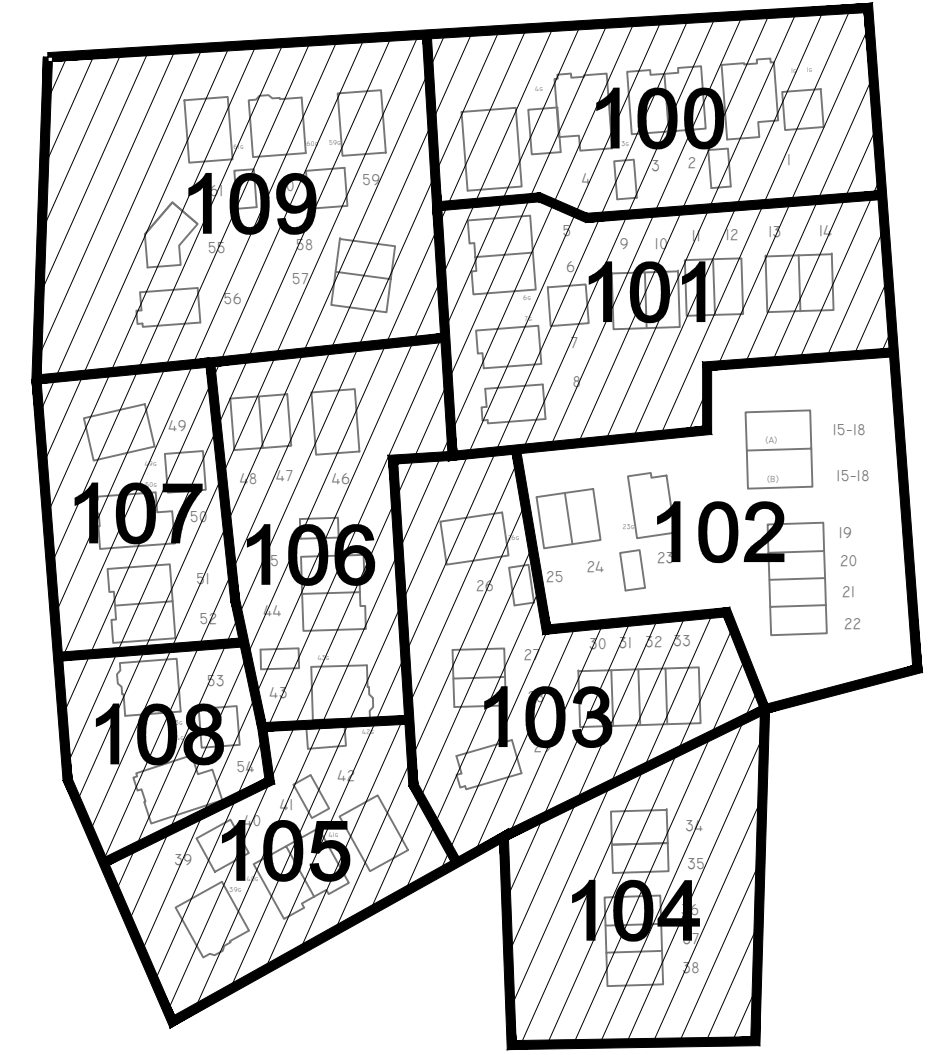


TARGET FOUNDATION SCHEDULE (Best case estimates only. No allowance for contingencies)																																				
1 - Depth of Excavation and bearing levels shown are indicative only. Actual depths to formation level are to be determined on site, and to be inspected by and agreed with GRM																																				
2 - FFL's shown should be consistent with external works drawings, and any anomalies are to be queried with GRM. FFL's are also subject to revisions on site.																																				
3 - For detailed hazard information refer to GRM Foundation Schedule.																																				
Rev	Plot	House Type	Finished Floor Level	Average EGL	Anticipated Foundation Strata	Additional Information on General Hazards	Reason for Foundation Depth				Anticipated Bearing Level of Vibro Replacement Column				Minimum Length of Vibro Replacement Column below FFL				Anticipated Bearing Level of Concrete Foundation				Average Depth of Foundation Below EGL	Depth of Foundation Below FFL				Cut- or Fill +	Type of Foundation	Floor Slab Type	Claymaster Required	Gas Membrane Required	Radon Membrane Required	Retaining Wall or Plot Specific Construction Detail Required	Min. Void Required Under B&B Floor	Plot
							1	2	3	4	1	2	3	4	1	2	3	4	1	2	3	4		1	2	3	4									
*	15/18 (A)	HOB WIL	113.600	113.160	Clay	Poor Strength Strata	Old Trees	Old Trees	Geology	Geology	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	111.130	111.510	111.390	111.310	1.825	2.470	2.090	2.210	2.290	0.29	Planned & Supervised Dig	B&B	Yes	No	No	No	0.250	15/18 (A)
*	15/18 (B)	HOB WIL	113.600	113.233	Clay	Poor Strength Strata	Geology	Old Trees	Old Trees	Pipe	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	111.390	111.510	111.580	111.440	1.753	2.210	2.090	2.020	2.160	0.22	Planned & Supervised Dig	B&B	Yes	No	No	No	0.250	15/18 (B)
*	19	HUT	113.800	113.400	Clay	Trees																0.25	Pile and Ground Beam	B&B	Yes	No	No	No	No	0.250	19					
*	20	HUT	113.800	113.445	Clay	Trees																0.21	Pile and Ground Beam	B&B	Yes	No	No	No	No	0.250	20					
*	21	HUT	113.800	113.485	Clay	Trees																0.17	Pile and Ground Beam	B&B	Yes	No	No	No	No	0.250	21					
*	22	HUT	113.800	113.478	Clay	Trees																0.12	Pile and Ground Beam	B&B	Yes	No	No	No	No	0.250	22					
*	23	CDY	113.200	112.878	Clay	-	Min Depth	Min Depth	Pipe	Min Depth	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	111.990	112.060	111.900	111.900	0.915	1.210	1.140	1.300	1.300	0.09	Traditional	B&B	No	No	No	No	0.250	23
*	23G	SG02	112.850	112.860	Clay	-	Min Depth	Old Trees	Min Depth	Min Depth	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	111.800	111.700	111.800	111.800	1.085	1.050	1.150	1.050	1.050	0.04	Traditional	B&B	No	No	No	No	0.250	23G
*	24	BRK	112.900	112.693	Clay	-	Pipe	Min Depth	Min Depth	Pipe	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	111.057	111.850	111.760	110.908	1.299	1.843	1.050	1.140	1.992	0.06	Traditional	B&B	No	No	No	No	0.250	24
*	25	BRK	112.900	112.585	Clay	-	Pipe	Min Depth	Min Depth	Pipe	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	110.908	111.760	111.650	111.160	1.216	1.992	1.140	1.250	1.740	0.12	Traditional	B&B	No	No	No	No	0.250	25

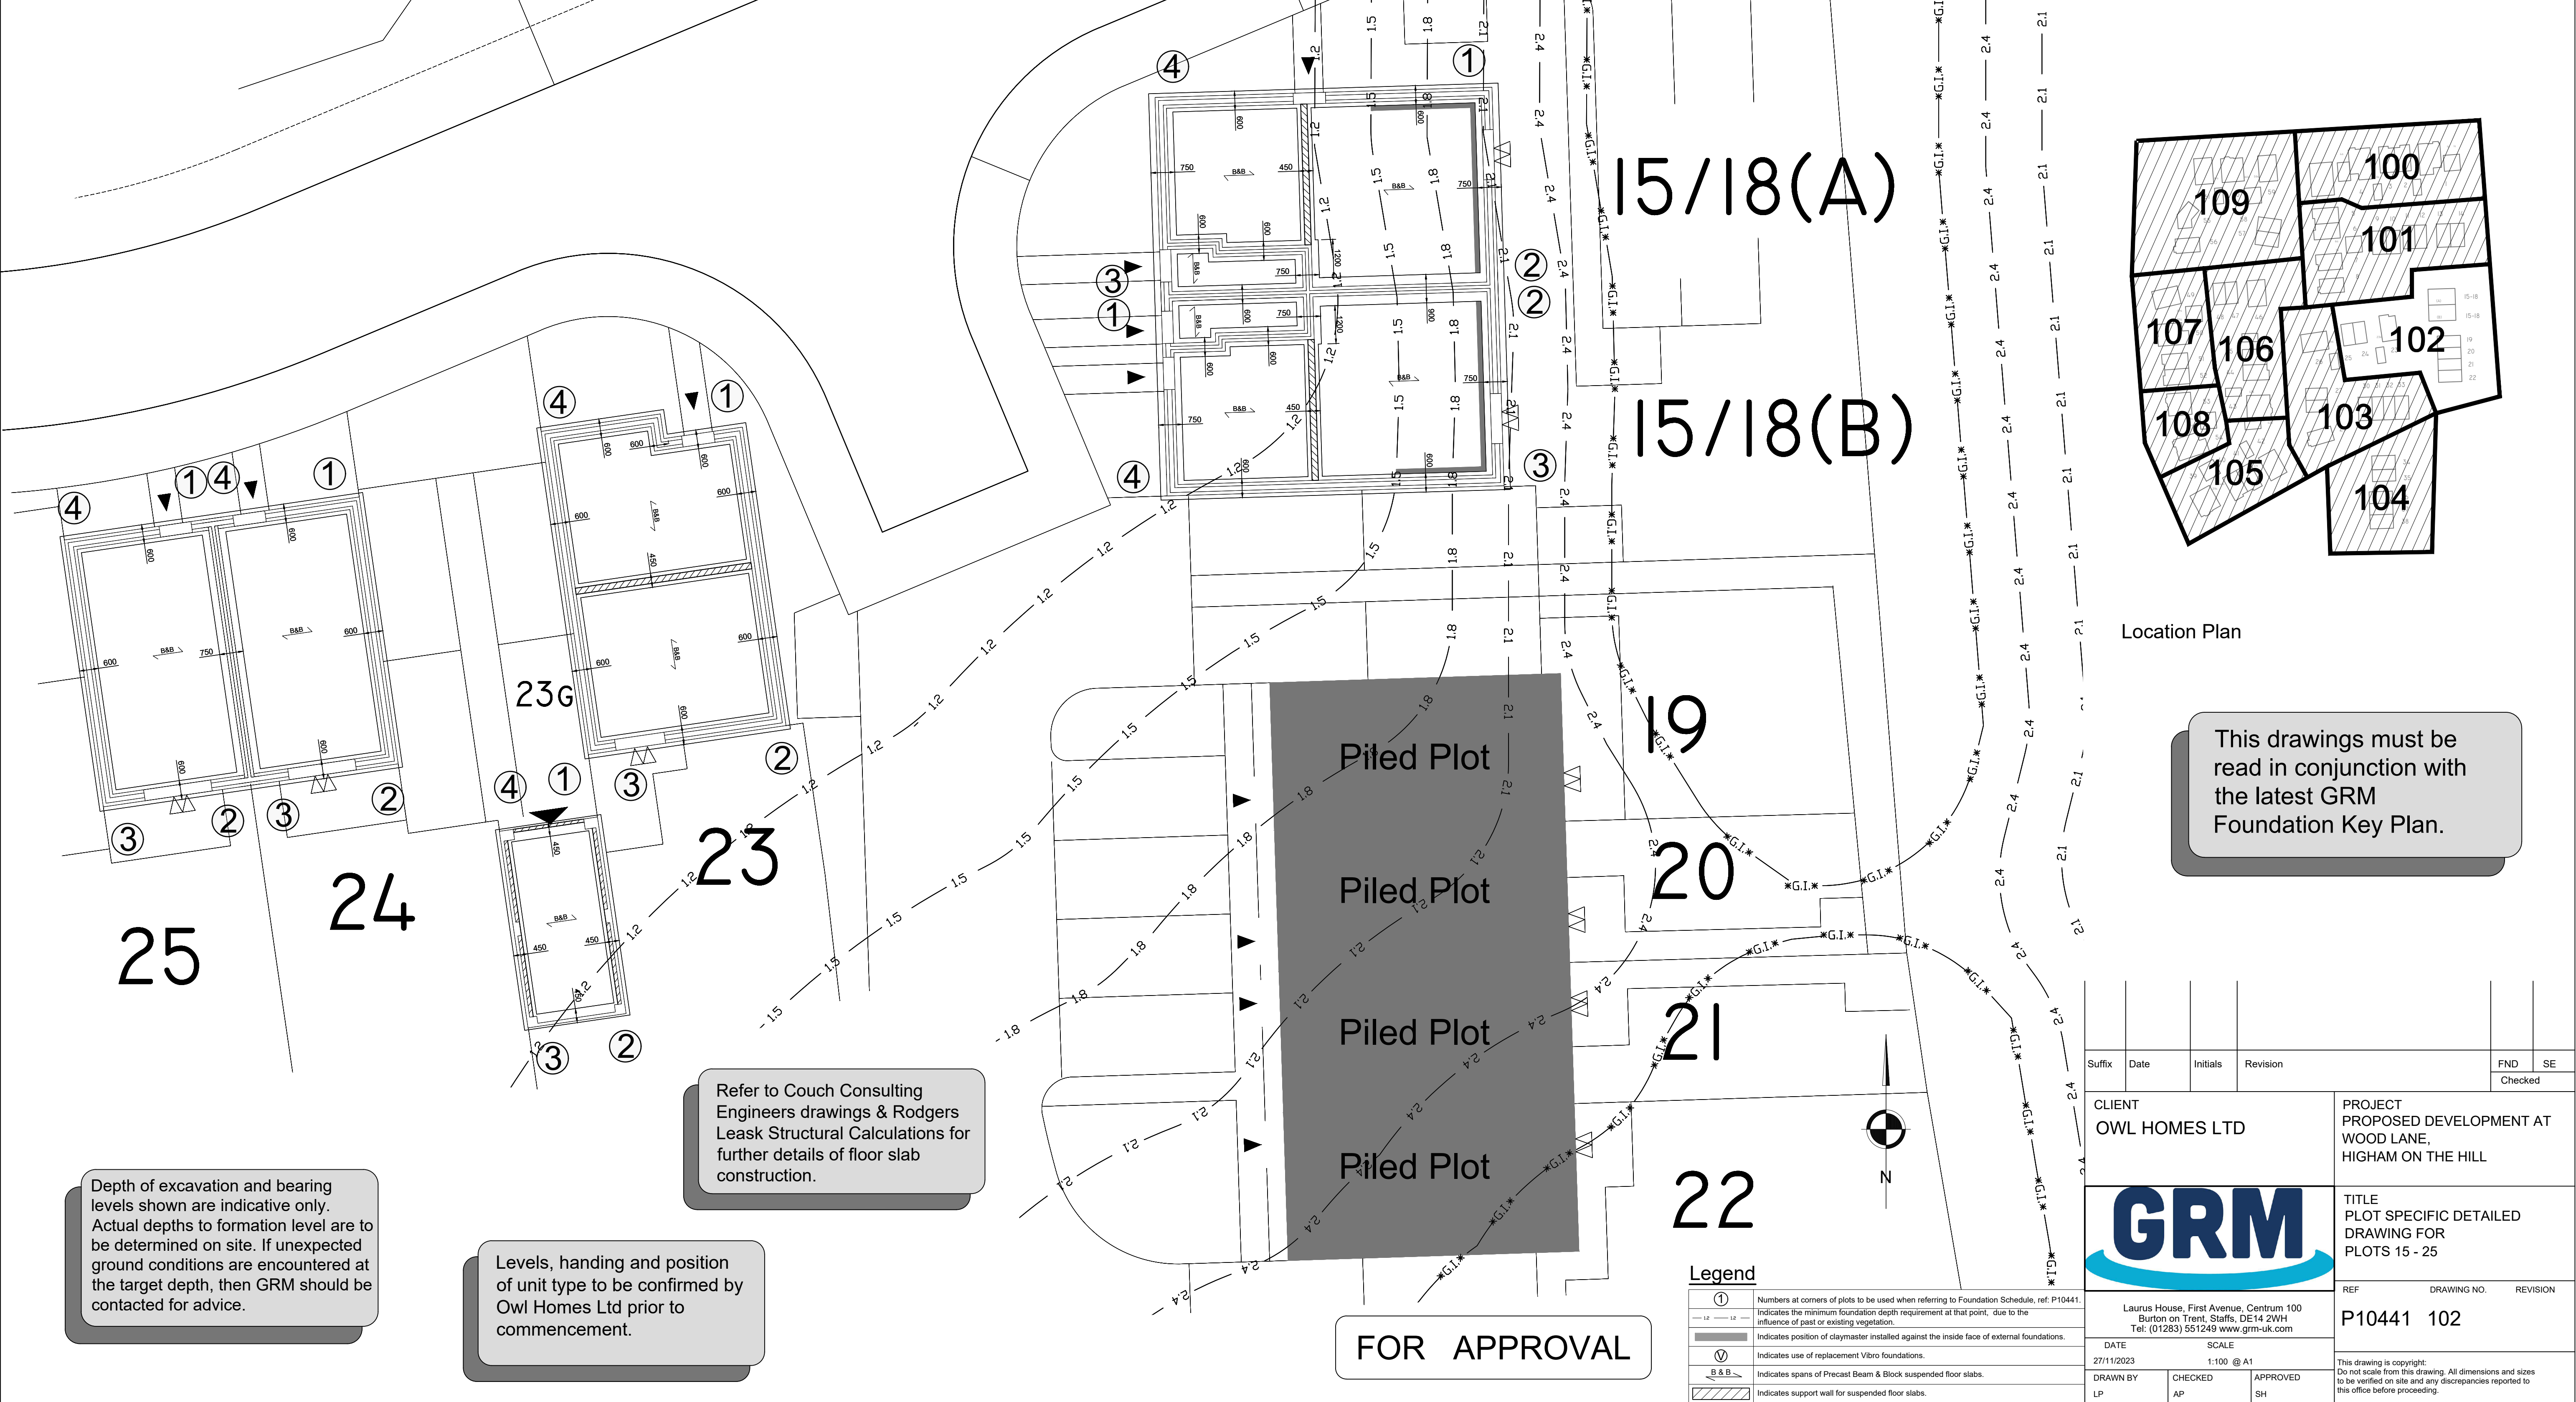

Location Plan

This drawings must be read in conjunction with the latest GRM Foundation Key Plan.

Suffix	Date	Initials	Revision	FND	SE
				Checked	
CLIENT OWL HOMES LTD				PROJECT PROPOSED DEVELOPMENT AT WOOD LANE, HIGHAM ON THE HILL	
				TITLE PLOT SPECIFIC DETAILED DRAWING FOR PLOTS 15 - 25	
Laurus House, First Avenue, Centrum 100 Burton on Trent, Staffs, DE14 2WH Tel: (01283) 551249 www.grm-uk.com				REF	DRAWING NO. REVISION
DATE 27/11/2023				SCALE 1:100 @ A1	
DRAWN BY LP	CHECKED AP	APPROVED SH	This drawing is copyright: Do not scale from this drawing. All dimensions and sizes to be verified on site and any discrepancies reported to this office before proceeding.		