



3 - For detailed hazard information refer to GRM Foundation Schedule.

Rev	Plot	House Type	Finished Floor Level	Average EGL	Anticipated Foundation Strata	Additional Information on General Hazards	Reason for Foundation Depth				Anticipated Bearing Level of Vibro Replacement Column				Minimum Length of Vibro Replacement Column below FFL				Anticipated Bearing Level of Concrete Foundation				Average Depth of Foundation Below EGL	Depth of Foundation Below FFL				Cut- or Fill +	Type of Foundation	Floor Slab Type	Claymaster Required	Gas Membrane Required	Radon Membrane Required	Retaining Wall or Plot Specific Construction Detail Required	Min. Void Required Under B&B Floor	Plot
							1	2	3	4	1	2	3	4	1	2	3	4	1	2	3	4		1	2	3	4									
*	39	LMG	112.050	111.600	Clay	-	Old Trees	Old Trees	Old Trees	Old Trees	N/A	N/A	N/A	N/A	N/A	109.050	109.170	109.950	110.130	2.025	3.000	2.880	2.100	1.920	0.29	Traditional	B&B	Yes	No	No	No	No	0.250	39		
-	39/40G	SDG01	111.900	111.765	Clay	-	Old Trees	Old Trees	Old Trees	Old Trees	N/A	N/A	N/A	N/A	N/A	109.920	109.910	110.610	110.620	1.500	1.980	1.990	1.290	1.280	0.17	Traditional	B&B	No	No	No	No	No	0.250	39/40G		
*	40	CDY	112.200	111.823	Clay	-	Min Depth	Old Trees	Min Depth	Min Depth	N/A	N/A	N/A	N/A	N/A	110.870	110.620	110.960	110.940	0.975	1.330	1.580	1.240	1.260	0.19	Traditional	B&B	No	No	No	No	No	0.250	40		
*	41	CDY	112.200	111.870	Clay	-	Min Depth	Min Depth	Min Depth	Min Depth	N/A	N/A	N/A	N/A	N/A	110.940	110.960	111.010	110.970	0.900	1.260	1.240	1.190	1.230	0.18	Traditional	B&B	No	No	No	No	No	0.250	41		
*	41G	SG02	112.050	111.900	Clay	-	Min Depth	Min Depth	Min Depth	Min Depth	N/A	N/A	N/A	N/A	N/A	111.000	110.960	111.000	111.000	0.910	1.050	1.090	1.050	1.050	0.25	Traditional	B&B	No	No	No	No	No	0.250	41G		
*	42	TWY	112.600	112.000	Clay	-	Manhole	Pipe	Min Depth	Min Depth	N/A	N/A	N/A	N/A	N/A	110.325	110.585	111.060	111.160	1.218	2.275	2.015	1.540	1.440	0.38	Traditional	B&B	No	No	No	No	No	0.250	42		
*	42G	SG02	112.300	111.965	Clay	Variable and Poor Strength Strata	STC	Min Depth	Min Depth	STC	108.500	108.410	108.420	108.500	3.800	3.890	3.880	3.800	111.100	111.010	111.020	111.100	0.907	1.200	1.290	1.280	1.200	0.33	Vibro-Replacement	B&B	No	No	No	No	0.250	42G

Depth of excavation and bearing levels shown are indicative only. Actual depths to formation level are to be determined on site. If unexpected ground conditions are encountered at the target depth, then GRM should be contacted for advice.

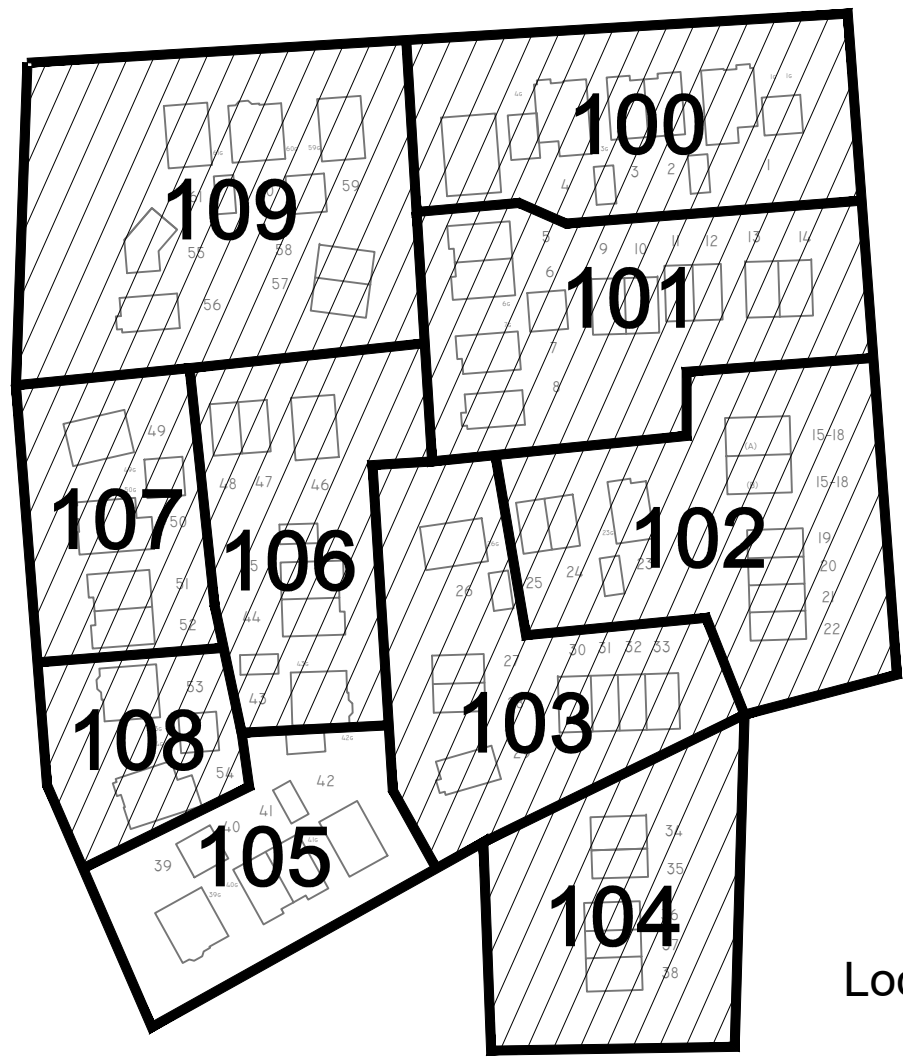

Location Plan

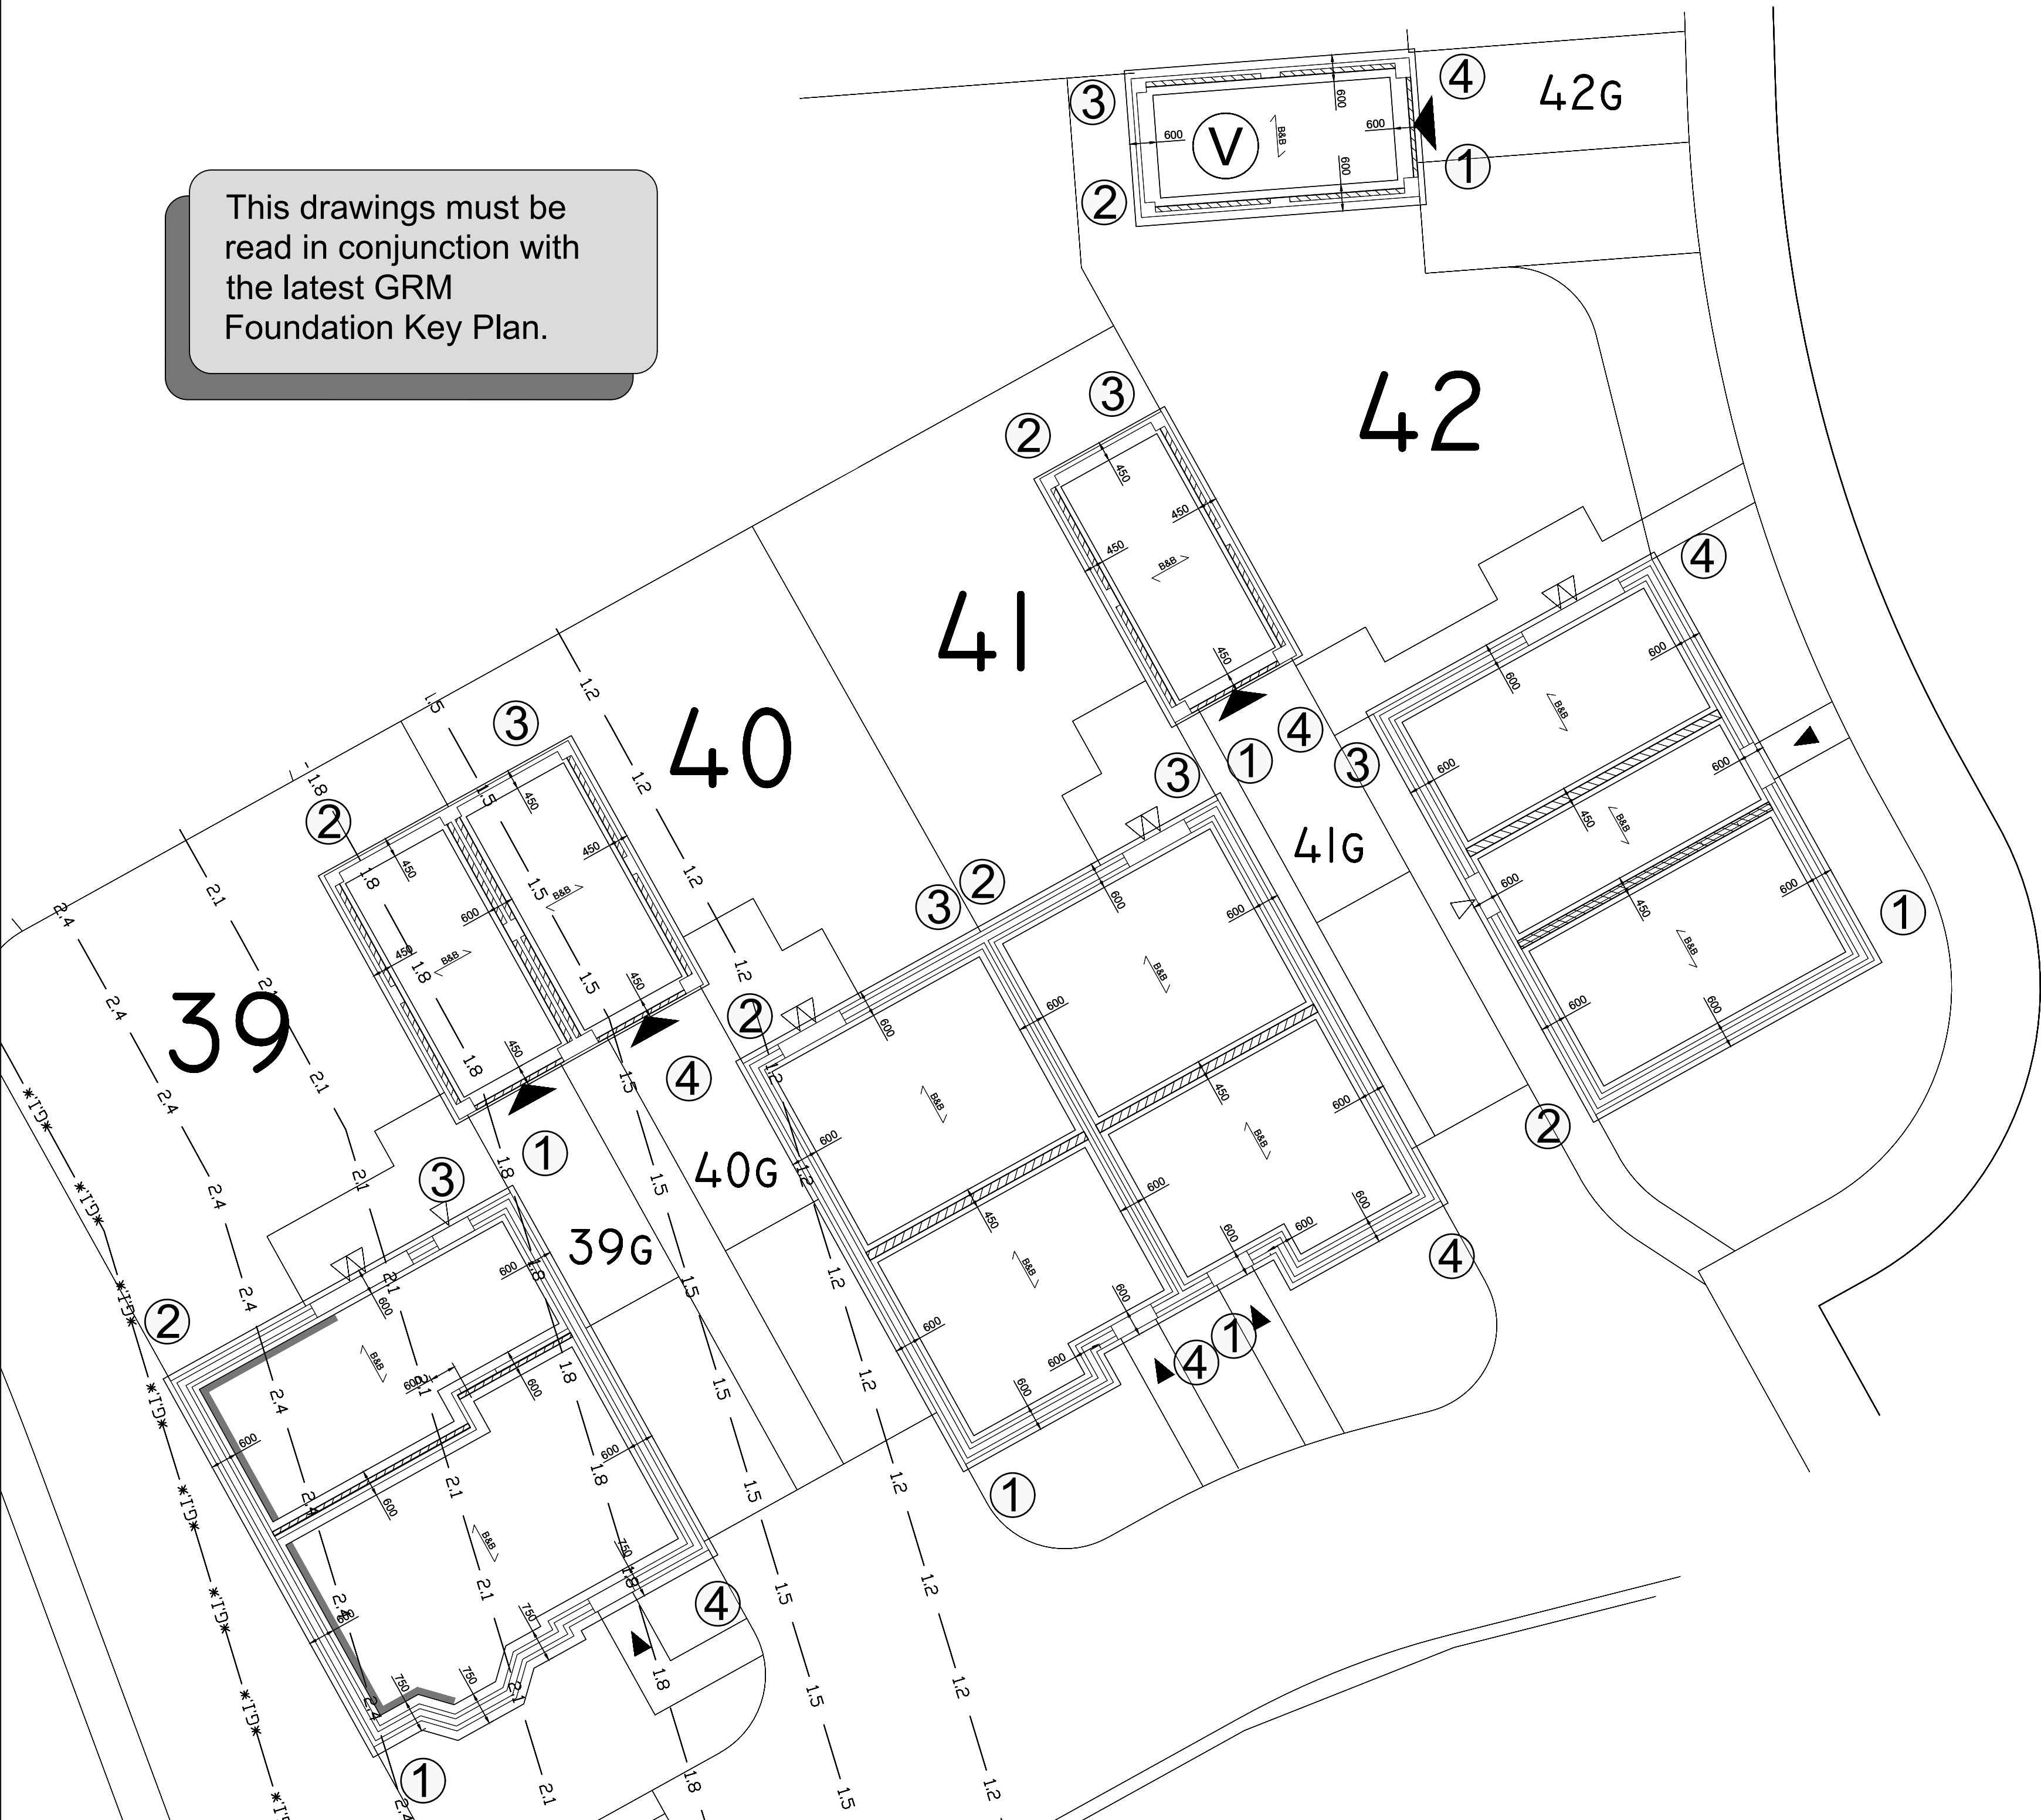

FOR APPROVAL

	Number of corners of plots to be used when referring to Foundation Schedule, ref. P10441
	Indicates the minimum foundation depth requirement at that point, due to the influence of past or existing vegetation.
	Indicates position of claymaster installed against the inside face of external foundations.
	Indicates use of replacement Vibro foundations.
	Indicates spans of Precast Beam & Block suspended floor slabs.
	Indicates support wall for suspended floor slabs.

Suffix	Date	Initials	Revision						
				FND	SE				
				Checked					
CLIENT OWL HOMES LTD				PROJECT PROPOSED DEVELOPMENT AT WOOD LANE, HIGHAM ON THE HILL					
				TITLE PLOT SPECIFIC DETAILED DRAWING FOR PLOTS 39 - 42G					
Laurus House, First Avenue, Centrum 100 Burton on Trent, Staffs, DE14 2WH Tel: (01283) 551249 www.grm-uk.com				REF		DRAWING NO.		REVISION	
DATE 27/11/2023				SCALE 1:100 @ A1		P10441 105			
DRAWN BY LP	CHECKED AP	APPROVED SH		This drawing is copyright: Do not scale from this drawing. All dimensions and sizes to be verified on site and any discrepancies reported to this office before proceeding.					